


WAC3 Assembling instruction

1. Strip lenhth (mm)

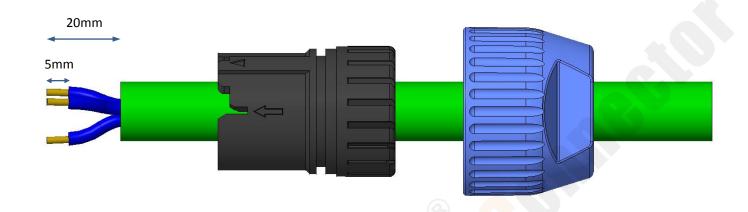


2. Put the wire into contacts and tighten the wire with screw (Torque 0.15-0.2Nm) ;






3. Arrow pointing to the slot, push in along the axis to make the two parts fit together

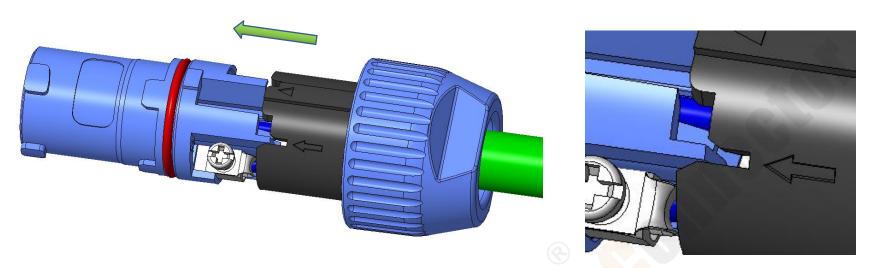


4. Align the two triangle marks as show in below picture, push in axially to the end, tighten the compression nut with torque of 0.9-1.2Nm

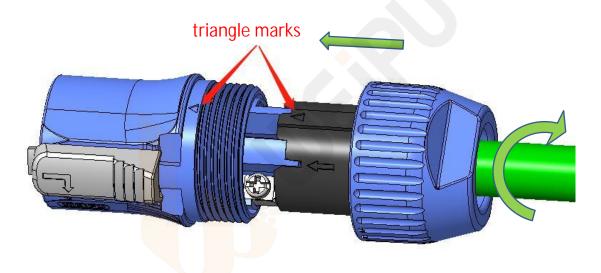



 5. Align the triangle mark with the positioning slot as show in below picture, push in the plug axially to the end, and turn it clockwise with torque of 0.4-0.5Nm, the plug and socket has been connected when hearing a "click" sound.







6. Press the lock button and push it back to the end counterclockwise with torque of **0.4-0.5Nm** as show in below picture, pull the plug out axially for disconnecting.

